Unit: Bq/L

	В	

				Ornt. Dq/L
	Seawater of the south water outlet Note (near the drainage channel exit) (T-2)	Drainage channel C OP.35 exit (C-2)	Point near the main gate in the drainage channel C Note 2 (C-0)	Point near Fureai Intersection in the drainage channel B Note 2 (B-0-1)
Date of Sampling	Mar 13, 2014	Mar 13, 2014		Mar 13, 2014
Time of sampling	8:00 AM	7:51 AM		7:31 AM
Cs-134(Approx. 2 years)	ND(1.2)	ND(17)		ND(16)
Cs-137(Approx.30 years)	ND(1.4)	ND(24)		ND(23)
Gross β	ND(18)	ND(14)		16

Note 1: Approx. 330m south	from Unit 1-4 water outlet (T-2)	

Note 2: Water inflow location of drainage channel to the tank area

<Reference> The Highest Dose Until the Previous Measurement

Unit:	Rd/	L
-------	-----	---


	Seawater of the south water outlet Note 1 (near the drainage channel exit) (T-2)	Drainage channel C OD 35	Point near the main gate in the drainage channel C Note 2 (C-0)
Cs-134(Approx. 2 years)	3.5 [11/9]	45 [9/26]	20 <2/15>
Cs-137(Approx.30 years)	8.1 (9/15,11/9)	130 [9/26]	51 <2/15>
Gross β	ND	2,500 [10/24]	120 <2/15>

Unit: Ba/L

			Offit. Dq/L
	Point near Fureai Intersection in the drainage channel B Note 2 (B-0-1)	Side ditch next to the tank (point immediately short of the junction with the drainage channel C) (X-1)	Side ditch next to the tank (X-2)
Cs-134(Approx. 2 years)	70 [9/4]	450 [10/4]	260 [11/10]
Cs-137(Approx.30 years)	190 (9/4)	990 [10/4]	530 [11/10]
Gross β	380 [9/2]	15,000 [10/2]	15,000 [10/14]

^{*} Sampling date is provided in parentheses. []: 2013, <>: 2014

	Side ditch next to the tank (point immediately short of the junction with the drainage channel C) (X-1)	Side ditch next to the tank (X-2)
Date of Sampling	Mar 13, 2014	Mar 13, 2014
Time of sampling	7:42 AM	7:40 AM
Cs-134(Approx. 2 years)	34	30
Cs-137(Approx.30 years)	71	94
Gross β	2300	480

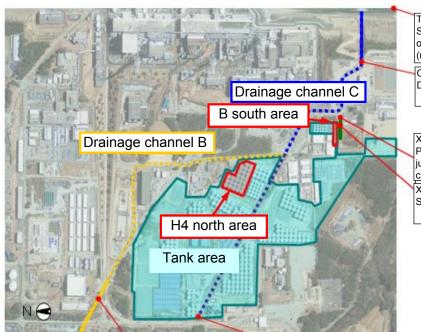

* The ducting is provided in the dot line.

B-0-1 Point near Fureai Intersection in the drainage channel B

Point near the main gate in the drainage channel C

Seawater of the south water

(near the drainage channel exit)

Drainage channel C O.P.35 exit

Point immediately short of the junction with the drainage channel C

X-2

Side ditch next to the tank

^{* &}quot;ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.

^{*} The sampling point and frequency has been changed since March 13, 2014.