
## Survey Status of Trenches etc. at Fukushima Daiichi Nuclear Power Station (Preliminary Report on February 13, 2012)

February 13, 2012 Tokyo Electric Power Company

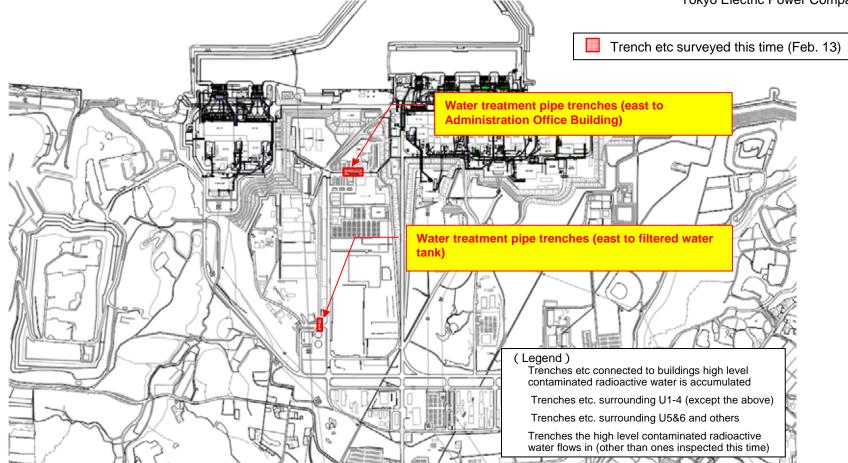

Surveyed on	Place	Accumulated	Dose rate at the surface of vessels	Nuclide analysis results ( Bq/cm <sup>3</sup> )			
	Trace	water	containing samples	I - 131	Cs-134	Cs-137	
2 / 1 3	In water treatment pipe trenches (east to Administration Office Building)	Yes	Approx. 6.0 µ Sv/h	ND	2.2 × 10°	3.3 × 10º	
	In water treatment pipe trenches (east to filtered water tank)	No	-	_	-	-	

## Fukushima Daiichi Nuclear Power Station: List of result of survey on trenches etc.

## February 13, 2012 Tokyo Electric Power Company

[Survey area ] Trenches connected to Buildings of U1-4, Centralized Radioactive Waste Treatment Facilities

[Survey area ] Trenches etc. surrounding U1-4 (except trenches etc in area )

Surveye d on	Place	Accumulated water	Dose rate at the surface of vessels containing samples (µSv/h)	Nuclide analysis results (Bq/cm <sup>3</sup> )					Dose rate at	Nuclide analysis results (Bq/cm <sup>3</sup> )			
				l-131	Cs-134	Cs-137	Surveyed on	Place	ed water	the surface of vessels containing samples ( µ Sv/h)	I-131	Cs-134	Cs-137
1 / 11	In duct connecting U2 to 4 DG	Yes	9.0	ND	1.9 × 10 <sup>0</sup>	2.6 × 10 <sup>0</sup>	1 / 24	In trench connecting U1 boiler room and electricity room	Yes	1.0	ND	7.9 × 10 <sup>-1</sup>	1.0 × 10 <sup>0</sup>
	In duct connecting water treatment building to U1 T/B	Yes	1.5	ND	8.8 × 10 <sup>-1</sup>	1.3 × 10 <sup>0</sup>		In trench U3&4 Oil pipes	No	-	-	-	-
	In U1 chemical tank connection duct	Yes	1.2	ND	2.4 × 10 <sup>0</sup>	3.5 × 10 <sup>0</sup>		In duct for U4 main transformer cables	Yes	1.0	ND	7.5 × 10⁻¹	1.0 × 10 <sup>0</sup>
	In duct for U3 start-up transformer cables	Yes	1.6	ND	4.9 × 10 <sup>1</sup>	6.9 × 10 <sup>1</sup>		In connection duct for U1 water	Yes	2.0	ND	1.2 × 10 <sup>1</sup>	1.5 × 10 <sup>1</sup>
	In duct for U3 radioactive liquid pipes	No	-	-	-	-		surge tank	165	2.0		1.2 × 10	1.3 × 10
	In duct for U1 radioactive liquid pipes	Yes	9.0	ND	1.4 × 10 <sup>0</sup>	1.9 × 10 <sup>0</sup>	1 / 25	In duct for U1 main transformer cables	Yes	2.0	ND	1.5 × 10 <sup>0</sup>	2.3 × 10 <sup>0</sup>
1 / 13	In duct for U4 radioactive liquid pipes	Yes	2.5	ND	2.2 × 10 <sup>1</sup>	2.8 × 10 <sup>1</sup>		In trench for fire extinction pipes	Yes	4.0	ND	ND	1.0 × 10 <sup>-1</sup>
1 / 16	In duct for U1 intake power cables	Yes	5.5	ND	2.3 × 10 <sup>0</sup>	3.2 × 10 <sup>0</sup>		In duct for U1 off gas pipes	Yes	3.0	ND	5.5 × 10 <sup>-1</sup>	8.9 × 10 <sup>-1</sup>
	In duct for U1 backup power cables	Yes	10	ND	5.4 × 10 <sup>-1</sup>	8.0 × 10 <sup>-1</sup>		In duct for holding up activated	Yes	1.8	ND	1.6 × 10 <sup>-1</sup>	2.7 × 10 <sup>-1</sup>
1 / 17	In duct for U2 radioactive liquid pipes	No	-	-	-	-	1 / 26	charcoal, U1					
	In U3 chemical tank connection duct	No	-	-	-	-		In duct for U2 main transformer cables	Yes	1.2	ND	8.1 × 10 <sup>-1</sup>	1.1 × 10 <sup>0</sup>
	In U4 chemical tank connection duct	Yes	3.0	ND	1.3 × 10º	1.7 × 10 <sup>0</sup>		In connection duct for U2 water	No				
1 / 18	In tunnel for U1 seawater pipes	Yes	1.3	ND	2.9 × 10 <sup>-1</sup>	4.4 × 10 <sup>-1</sup>		surge tank					
	In duct for U1 common piles	Yes	1.0	ND	1.0 × 10 <sup>1</sup>	1.5 × 10 <sup>1</sup>		In trench for in house common boiler for U2&3	No				
	In duct for U1 control cables	Yes	4.5	ND	4.8 × 10 <sup>-1</sup>	7.1 × 10 <sup>-1</sup>		In duct for U3 main transformer	Yes	1.8	ND	1.4 × 10 <sup>0</sup>	1.8 × 10 <sup>0</sup>
	In tunnel for U4 seawater pipes	No	-	-	-	-		cables In trench for U2 transformer fire				-	
1 / 19	In tunnel for U2 seawater pipes	No	-	-	-	-	1 / 30	prevention	Yes	9.5	ND	2.1 × 10 <sup>0</sup>	3.0 × 10 <sup>0</sup>
	In circular pump discharge valve pit for in U2 pump room	Yes	45	ND	7.1 × 10 <sup>3</sup>	9.1 × 10 <sup>3</sup>	1 / 31	In duct for U1 start-up transformer cables	Yes	1.3	ND	2.2 × 10 <sup>0</sup>	3.0 × 10 <sup>0</sup>
	In circular pump discharge valve pit for in U3 pump room	Yes	21	ND	3.8 × 10 <sup>2</sup>	4.8 × 10 <sup>2</sup>	1731	In trench to the north of former admin. building	No	-	-	-	-
	In duct for common pipes for wastes of Centralized environment Facilities	Yes	5.0	ND	7.3 × 10 <sup>-1</sup>	9.4 × 10 <sup>-1</sup>							
1 / 20	In duct for U3 off gas pipes	Yes	4.0	ND	3.1 × 10 <sup>1</sup>	4.1 × 10 <sup>1</sup>							
1 / 31	In circular pump discharge valve pit for in U4 pump room*	Yes	1.3	ND	4.5 × 10 <sup>0</sup>	6.3 × 10 <sup>0</sup>							

\* Surveyed again since the sampling spot was not correct.

## Fukushima Daiichi Nuclear Power Station: List of result of survey on trenches etc.

[Survey area ] Trenches etc. surrounding U5&6 and others

February 13, 2012 Tokyo Electric Power Company

Survey	Place	Accumul ated	Dose rate at the surface of vessels	Nuclide analysis results ( Bq/cm 3 )			
ed on		water	containing samples	I-131	Cs-134	Cs-137	
2/6	In circular pump discharge valve pit for in U5 pump room	Yes	5.0	ND	1.0 × 10 <sup>-1</sup>	1.6 × 10 <sup>-1</sup>	
	In circular pump discharge valve pit for in U6 pump room	Yes	4.0	ND	1.1 × 10 <sup>-1</sup>	1.4 × 10 <sup>-1</sup>	
	In duct for U5 off gas pipes	No	-	-	-	-	
	In duct for U6 off gas pipes	Yes	1.0	ND	1.2 × 10 <sup>-1</sup>	1.9 × 10 <sup>-1</sup>	
	In oil pipe trench (southeast of U5)	No	-	-	-	-	
	In duct for U5 intake power cables	Yes	8.0	ND	1.4 × 10 <sup>-1</sup>	2.0 × 10 <sup>-1</sup>	
2/7	In tunnel for U5 seawater pipes	Yes	8.0	ND	8.2 × 10 <sup>-2</sup>	1.1 × 10 <sup>-1</sup>	
2/1	In duct for U5 main transformer cables	Yes	10	ND	7.3 × 10 <sup>-2</sup>	1.3 × 10 <sup>-1</sup>	
	In duct for U5 start-up transformer cables	Yes	8.0	ND	2.0 × 10 <sup>-1</sup>	2.9 × 10 <sup>-1</sup>	
	In duct for U6 intake power cables	Yes	3.0	ND	1.0 × 10 <sup>-1</sup>	8.3 × 10 <sup>-2</sup>	
2/8	In trench for U5&6 storm drain pipes	Yes	4.0	ND	1.7 × 10 <sup>-1</sup>	2.5 × 10 <sup>-1</sup>	
	In duct for U5 radioactive liquid pipes	Yes	3.0	ND	8.0 × 10 <sup>-2</sup>	1.3 × 10 <sup>-1</sup>	
	In trench for east of U5 heavy oil pipes	Yes	4.0	ND	2.0 × 10 <sup>-1</sup>	2.8 × 10 <sup>-1</sup>	
	In duct for U6 main transformer cables	Yes	3.0	ND	2.8 × 10 <sup>-1</sup>	4.3 × 10 <sup>-1</sup>	
	In communication cables of U5&6	Yes	4.0	ND	ND	7.2 × 10 <sup>-2</sup>	
	Duct for emergency gas processing pipes	Yes	1.0	ND	4.6 × 10 <sup>-1</sup>	6.7 × 10 <sup>-1</sup>	
	Duct for U5 chemical tank connection	No	-	-	-	-	
	In suppression pool water pipe trenches	No	-	-	-	-	
2/9	In common suppression pool water surge pipe duct	No	-	-	-	-	
	In trench for fire extinction pipes (west to Unit 5)	No	-	-	-	-	
	In trench for fire extinction pipes (west to Unit )	No	-	-	-	-	
	In trench for fire extinction pipes (south to Unit 5)	No	-	-	-	-	
2/10	In seawater pipe duct of U6 (SW system)	Yes	2.0	ND	2.1 × 10 <sup>-1</sup>	3.4 × 10 <sup>-1</sup>	
	In seawater pipe duct of U5 (SW system)	Yes	2.0	ND	1.4 × 10 <sup>-1</sup>	1.5 × 10 <sup>-1</sup>	
	In light oil pipe trenches, No.6	Yes	1.6	ND	2.5 × 10 <sup>-1</sup>	3.7 × 10 <sup>-1</sup>	
	In pipe duct of U6 (pump room ~ MG set building)	Yes	1.6	ND	1.1 × 10 <sup>-1</sup>	2.0 × 10 <sup>-1</sup>	
	In seawater pipe duct of U6 (for north emergency system)	Yes	1.6	ND	ND	1.2 × 10 <sup>-1</sup>	
	In seawater pipe duct of U6 (for south emergency system)	Yes	1.2	ND	1.4 × 10 <sup>-1</sup>	2.0 × 10 <sup>-1</sup>	